

Manhole Inspection Summary

Manhole # S19GG2014MH

Printed On: 12/17/2008

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **19GG2** Node: **014** Status: **Found**

Insp Date: **9/19/06 1:42 PM**

Incomplete Comments

Crew: **CH, HDP, JJ**
Inspector: **Jensen, J**
Firm: **RKK**

Location Address: **1330 OLIVER ST**

Cross Street: **SMITH AVE**

Manhole Type: **Inline** Location: **Grass**

Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **30** (in.) Length: (in.) Dist A/B Grade: **4** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ Joint ☐ Cracks ☒ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ Mortar ☐ Roots ☒ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged ☒ Debris (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged ☒ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **11** Missing: **0** ☒ Corroded

Surcharge ☒ Evidence Of Surcharge Depth: **2** (ft.) ☐ Active Surcharge Present

Location View



Top View



Corroded steps. Evidence of surcharge - Bench debris. Channel debris.

Defect



Corbel infiltration.

Defect



Barrel infiltration.


Manhole Inspection Summary

Manhole # S19GG2014MH

Printed On: 12/17/2008

Page 3 of 3

8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock

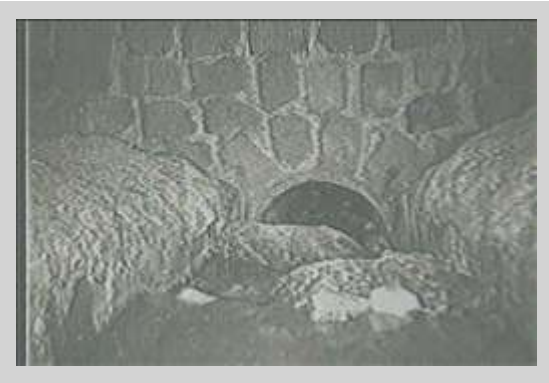

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **17.38** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☒ **Grease**

Silt Depth: **4** (in.) Deposits Extent: **Medium**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer Pipe In @ 6 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **11.74** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **0** (in.) Deposits Extent: **Light**

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop In @ 6 O'Clock



Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **16.08** (ft.)

Inv Depth: **17.08** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection